COMPREHENSIVE SERVICES

We offer competitive repair and calibration services, as well as easily accessible documentation and free downloadable resources.

SELL YOUR SURPLUS

We buy new, used, decommissioned, and surplus parts from every NI series. We work out the best solution to suit your individual needs.

Sell For Cash Get Credit Receive a Trade-In Deal

OBSOLETE NI HARDWARE IN STOCK & READY TO SHIP

We stock New, New Surplus, Refurbished, and Reconditioned NI Hardware.



Bridging the gap between the manufacturer and your legacy test system.

0

1-800-915-6216



www.apexwaves.com

sales@apexwaves.com

All trademarks, brands, and brand names are the property of their respective owners.

Request a Quote



PXI-5114

CALIBRATION PROCEDURE NI 5114

This document contains instructions for writing an external calibration procedure for the NI PXI/PXIe/PCI-5114. For more information about calibration, visit ni.com/calibration.

Contents

Software	2
Documentation	3
Password	4
Calibration Interval	4
External Calibration	4
Self-Calibration	4
Test Equipment	4
Calibration Procedures	5
Initial Setup	5
Test Conditions	5
Self-Calibration	6
MAX	6
NI-SCOPE Soft Front Panel	6
NI-SCOPE	7
Verification	8
Vertical Offset and Vertical Gain Accuracy	8
Programmable Vertical Offset Accuracy	18
Timing Accuracy	24
Bandwidth and Flatness	27
Trigger Sensitivity	32
Adjustment	37
Appendix A: Calibration	41
Complete Calibration	41
Appendix B: Calibration Utilities	42
MAX	42
NI-SCOPE	43
Where to Go for Support	43



Software

To calibrate the NI 5114, install the following versions of NI-SCOPE.

Device NI-SCOPE Version NI PXI-5114 2.9 or later NI PCI-5114 3.1 or later NI PXIe-5114 14.1 or later

Table 1. Required Software for NI 5114 Calibration

You can download NI-SCOPE from the Instrument Driver Network at ni. com/idnet. NI-SCOPE supports programming the Self-Calibration and Verification sections in a number of programming languages. However, only LabVIEW and C are supported for the Adjustment section.

NI-SCOPE includes all the functions and attributes necessary for calibrating the NI 5114. LabVIEW support is installed in niScopeCal.11b, and all calibration functions appear in the function palette. For LabWindowsTM/CVITM, the NI-SCOPE function panel niScopeCal.fp provides further help on the functions available in CVI. Refer to Table 2 for installed file locations

Calibration functions are LabVIEW VIs or C function calls in the NI-SCOPE driver. The C function calls are valid for any compiler capable of calling a 32-bit DLL. Many of the functions use constants defined in the niScopeCal.h file. To use these constants in C, you must include niScopeCal.h in your code when you write the calibration procedure.

For more information on the calibration VIs and functions, refer to the NI-SCOPE Function Reference Help or the NI-SCOPE LabVIEW Reference Help. These references can be found in the NI High-Speed Digitizers Help. Refer to the NI-SCOPE Readme for the installed locations of these documents.

File Name and Location	Description
IVI\Bin\niscope_32.dll	NI-SCOPE driver containing the entire NI-SCOPE API, including calibration functions.
IVI\Lib\msc\niscope.lib	NI-SCOPE library for Microsoft C containing the entire NI-SCOPE API, including calibration functions.
LabVIEW (version) \examples \ instr\niScope	Directory of LabVIEW NI-SCOPE example VIs, including self-calibration.

LabVIEW VI library containing VIs for calling the

NI-SCOPE calibration APL

Table 2. Calibration File Locations after Installing NI-SCOPE

instr.lib\niScopeCalibrate\

niScopeCal.11b

LabVIEW (version) \

Table 2. Calibration File Locations after Installing NI-SCOPE (Continued)

File Name and Location	Description
IVI\Drivers\niScope\ niScopeCal.fp	CVI function panel file that includes external calibration function prototypes and help on using NI-SCOPE in the CVI environment.
IVI\Include\niScopeCal.h	Calibration header file, which you must include in any C program accessing calibration functions. This file automatically includes niScope.h, which defines the rest of the NI-SCOPE interface.
IVI\Drivers\niScope\ Examples	Directory of NI-SCOPE examples for CVI, C, Visual C++, and Visual Basic.

Documentation

Consult the following documents for information about the NI PXI/PXIe/PCI-5114, NI-SCOPE, and your application software. All documents are available on ni. com, and the Help files install with the software.



NI High-Speed Digitizers Getting Started Guide

Contains: NI-SCOPE installation, hardware installation, and hardware programing



NI 5114 Specifications

Contains: NI PXI/PXIe/PCI-5114 specifications and calibration interval



NI-SCOPE Readme

Contains: Operating system and application software support in NI-SCOPE



NI High-Speed Digitizers Help

Contains: Detailed information about NI PXI/PXIe/PCI-5114



NI-SCOPE LabVIEW Reference Help

Contains: LabVIEW programming concepts and reference information about NI-SCOPE VIs and functions



NI-SCOPE Function Reference Help

Contains: Reference information for NI-SCOPE C functions and NI-SCOPE C properties

Password

The default calibration password is NI.

Calibration Interval

External Calibration

The measurement accuracy requirements of your application determine how often you should externally calibrate the NI 5114. NI recommends that you perform a complete external calibration at least once every two years. You can shorten this interval based on the accuracy demands of your application or the requirements of your processes. Refer to *Appendix A:*Calibration for more information.

Self-Calibration

Self-calibration can be performed as necessary to compensate for environmental changes.



Caution Although you can use self-calibration repeatedly, self-calibrating the NI 5114 more than a few times a day may cause excessive wear on the relays over time.

Test Equipment

Table 3 lists the equipment required for externally calibrating the NI 5114. If you do not have the recommended instruments, use these specifications to select a substitute calibration standard.

Table 3. Required Equipment Specifications for the NI 5114 External Calibration

Required Equipment	Recommended Equipment	Parameter Measured	Specification
Signal Generator	Fluke 9500B Oscilloscope Calibrator	DC Accuracy	DC \pm (0.025% + 25 μ V) into 1 M Ω
	or Wavetek 9500 (with high-stability reference option)	Bandwidth, Trigger Sensitivity	$\pm 2\%$ output amplitude flatness for leveled sine wave up to 125 MHz relative to 50 kHz into 50 Ω
	Fluke 9510 Test Head	Timing	±2 ppm frequency accuracy
BNC cable		_	50 Ω



Note The delay times indicated in this procedure apply specifically to the Fluke 9500B calibrator. If you use a different calibrator, you may need to adjust these delay times.

Calibration Procedures

The calibration process includes the following steps:

- Initial Setup—Install the device and configure it in Measurement & Automation Explorer (MAX).
- Self-Calibration—Adjust the self-calibration constants of the device. 2.
- 3. Verification—Verify the existing operation of the device. This step confirms whether the device is operating within its specified range prior to calibration.
- Adjustment—Perform an external adjustment of the device that adjusts the calibration 4. constants with respect to a known voltage source. The adjustment procedure automatically stores the calibration date on the EEPROM to allow traceability.
- Reverification—Repeat the verification procedure to ensure that the device is operating within its specifications after adjustment.

These steps are described in more detail in the following sections.

Initial Setup

Refer to the NI High-Speed Digitizers Getting Started Guide for information about how to install the software and hardware, and how to configure the device in MAX.

Test Conditions

Follow these guidelines to optimize the connections and the environment during calibration:

- Always connect the calibrator test head directly to the input BNC of the device, or use a short 50 Ω BNC coaxial cable if necessary. Long cables and wires act as antennas, picking up extra noise that can affect measurements.
- Keep relative humidity between 10 and 90% non-condensing, or consult the device hardware documentation for the optimum relative humidity.
- Maintain an ambient temperature of 23 ± 5 °C. The device temperature will be greater than the ambient temperature.
- Allow a warm-up time of at least 15 minutes after the NI-SCOPE driver is loaded. Unless manually disabled, the NI-SCOPE driver automatically loads with the operating system and enables the device. The warm-up time ensures that the measurement circuitry of the NI 5114 is at a stable operating temperature.
- Plug the PXI/PXI Express chassis or PC and the calibrator into the same power strip to avoid ground loops.
- (PXI/PXIe) Ensure that the PXI/PXI Express chassis fan speed is set to HIGH, the fan filters are removed, and the empty slots contain PXI chassis slot blockers and filler panels. For more information refer to the Maintain Forced-Air Cooling Note to Users document available at ni.com/manuals.
- Verify that all connections to the device, including front panel connections, are secure.
- Use shielded copper wire for all cable connections to the device. Use twisted-pair wire to eliminate noise and thermal offsets

Self-Calibration

The NI 5114 includes precise internal circuits and references used during self-calibration to adjust for time and temperature drift. The device gain, offset, flatness, and trigger timing are all corrected in self-calibration. Measuring the accuracy of these internal calibration circuits with another instrument during external calibration provides traceability for the verification procedure. Absolute accuracy is ensured by compensating for any error measured in the internal references



Note Self-calibrate the device before you perform *Verification*. NI-SCOPE includes self-calibration example programs for LabVIEW, CVI, and Microsoft Visual C.

You can initiate self-calibration using the following methods:

- MAX
- NI-SCOPE Soft Front Panel (SFP)
- NI-SCOPE



Note The device must be installed in MAX before it can be used in another program.

MAX

To initiate self-calibration from MAX, complete the following steps:

- Disconnect or disable any AC inputs to the device. 1.
- 2. Launch MAX.
- 3 Select My System» Devices and Interfaces» NI-DAQmx Devices.
- 4. Select the device that you want to calibrate.
- 5. Initiate self-calibration using one of the following methods:
 - Click Self-Calibrate in the upper right corner of MAX.
 - Right-click the name of the device in the MAX configuration tree and select **Self-Calibrate** from the drop-down menu.

NI-SCOPE Soft Front Panel

To initiate self-calibration from the NI-SCOPE Soft Front Panel (SFP), complete the following steps:

- 1 Disconnect or disable any AC inputs to the device.
- Launch the NI-SCOPE SFP, which is available at Start» All Programs» National Instruments»NI-SCOPE»NI-SCOPE Soft Front Panel
- Select the device you want to calibrate from the Select Device dialog box. The Select Device dialog box automatically opens when you launch the NI-SCOPE SFP.



Note To change the device, select **Edit**»Change Device, and select the new device that you want to calibrate.

- 4. Launch the Calibration dialog box by selecting **Utility**»**Self Calibration**.
- 5. Click **OK** to begin self-calibration.

NI-SCOPE

To self-calibrate the NI 5114 programmatically using NI-SCOPE, complete the following steps:

- Disconnect or disable any AC inputs to the device.
- 2. Open a session and obtain a session handle using the niScope Initialize VI.



Note Throughout the procedure, refer to the C/C++ function call parameters for the LabVIEW input values.

LabVIEW VI	C/C++ Function Call
	Call niScope_init with the following parameters:
resource name id query error out error in	vi: The returned session handle that you use to identify the instrument in all subsequent NI-SCOPE driver function calls resourceName: The device name assigned by MAX idQuery: VI_FALSE resetDevice: VI_TRUE

Self-calibrate the device using niScope Cal Self Calibrate VI.

LabVIEW VI	C/C++ Function Call
instrument handle channels Option error in	Call niScope_CalSelf Calibrate with the following parameters: sessionHandle: The instrument handle from niScope_init channelList: VI_NULL option: VI_NULL



Note Because the session is a standard session rather than an external calibration session, the new calibration constants are immediately stored in the EEPROM. Therefore, you can include this procedure in any application that uses the device.

End the session using the niScope Close VI. 4.

LabVIEW VI	C/C++ Function Call
instrument handle error in error out	Call niScope_close with the following parameter: vi: The instrument handle from niScope_init

Verification



Note After the 15-minute warm-up time, always self-calibrate the NI 5114 before beginning a verification procedure.

This section describes the program you must write to verify either the calibration test limits or the published specifications for the NI 5114.



Note If any of these tests fail after you perform an external adjustment, make sure that you have met the requirements listed in the *Test Equipment* and *Calibration Procedures* sections before you return the device to National Instruments for repair.

Vertical Offset and Vertical Gain Accuracy

Table 4 contains the input parameters for verifying both vertical offset accuracy and vertical gain accuracy of the NI 5114.

To verify vertical offset accuracy, complete the procedures described in the Vertical Offset Accuracy section for each of the 20 iterations listed in Table 4 for channel 0, then repeat the procedures for channel 1. The Calibration Test Limits and Published Specifications for vertical offset accuracy are shown in Table 5.

To verify vertical gain accuracy, complete the procedures described in the Vertical Gain Accuracy section for each of the 20 iterations listed in Table 7 for channel 0; then repeat the procedures for channel 1. The Calibration Test Limits and Published Specifications for vertical gain accuracy are shown in Table 6.

Table 4. NI 5114 Input Parameters for Vertical Offset Accuracy and Vertical Gain Accuracy Verification

Iteration	Max Input Frequency (MHz)	Range
1	125	0.04
2	125	0.1
3	125	0.2
4	125	0.4

Table 4. NI 5114 Input Parameters for Vertical Offset Accuracy and Vertical Gain Accuracy Verification (Continued)

Iteration	Max Input Frequency (MHz)	Range
5	125	1
6	125	2
7	125	4
8	125	10
9	125	20
10	125	40
11	20	0.04
12	20	0.1
13	20	0.2
14	20	0.4
15	20	1
16	20	2
17	20	4
18	20	10
19	20	20
20	20	40

Vertical Offset Accuracy

Complete the following steps to verify vertical offset accuracy of the NI 5114. You must verify both channels with each iteration listed in Table 5.

Open a session and obtain a session handle using the niScope Initialize VI.



Note Throughout the procedure, refer to the C/C++ function call parameters for the LabVIEW input values.

LabVIEW VI	C/C++ Function Call
resource name instrument handle id query error out error in	Call niScope_init with the following parameters: resourceName: The device name assigned by MAX idQuery: VI_FALSE resetDevice: VI_TRUE

2. Configure the input impedance and the maximum input frequency using the niScope Configure Chan Characteristics VI.

LabVIEW VI	C/C++ Function Call
instrument handle out channel name input impedance max input frequency error in	Call niScope_ConfigureChan Characteristics with the following parameters: vi: The instrument handle from niScope_init channelList: "0" inputImpedance: NISCOPE_VAL_1_MEG_OHM maxInputFrequency: The Maximum Input Frequency value in Table 5 for the current iteration

Configure the common vertical properties using the niScope Configure Vertical VI. 3.

LabVIEW VI	C/C++ Function Call
vertical coupling probe attenuation	Call niScope_Configure Vertical with the following parameters: coupling: NISCOPE_VAL_DC probeAttenuation: 1.0
instrument handle out channel name vertical range vertical offset	vi: The instrument handle from niScope_init channelList: "0"
error in channel enabled channel enabled	range: The Range value in Table 4 for the current iteration offset: 0.0
	enabled: NISCOPE_VAL_TRUE

Configure the horizontal properties using the niScope Configure Horizontal Timing VI.

LabVIEW VI	C/C++ Function Call
enforce realtime number of records instrument handle min sample rate reference position error in min record length	Call niScope_Configure HorizontalTiming with the following parameters: enforceRealtime: NISCOPE_VAL_TRUE numRecords: 1 vi: The instrument handle from niScope_init minSampleRate: 10,000,000 refPosition: 50.0 minNumPts: 100,000

5. Commit all the parameter settings to hardware using the niScope Commit VI.

LabVIEW VI	C/C++ Function Call
instrument handle instrument handle out	Call niScope_Commit with the following parameter: vi: The instrument handle from niScope_init

Short-circuit the channel 0 input of the device by connecting the calibrator test head directly to the device and grounding the output of the calibrator.

- 7. Wait 500 ms for the calibrator to ground its output.
- 8. Initiate a waveform acquisition using the niScope Initiate Acquisition VI.

LabVIEW VI	C/C++ Function Call
instrument handle instrument handle out error in	Call niScope_Initiate Acquisition with the following parameter: vi: The instrument handle from niScope_init

Fetch a waveform from the device and perform a voltage average measurement using the niScope Fetch Measurement (poly) VI. Select the Measurement Scalar DBL instance of the VI.

LabVIEW VI	C/C++ Function Call
instrument handle out channels scalar measurement error in	Call niScope_Fetch Measurement with the following parameters: timeout: 1.0 vi: The instrument handle from niScope_init channelList: "0" scalarMeasFunction: NISCOPE_VAL_VOLTAGE _AVERAGE

Compare the resulting average voltage to the value listed in the *Published Specifications* column in Table 5 that corresponds to the settings used. If the result is within the selected test limit, the device has passed this portion of the verification.

- 10. Repeat steps 2 through 9 for each iteration in Table 4.
- 11. Move the calibrator test head to device input channel 1 and repeat steps 2 through 10 for every configuration in Table 4, changing the value of the **channelList** parameter from "0" to "1".
- 12. End the session using the niScope Close VI.

LabVIEW VI	C/C++ Function Call
instrument handle error in error out	Call niScope_close with the following parameter: vi: The instrument handle from niScope_init

Table 5. NI 5114 Vertical Offset Limits

	Calibration Test Limits (V)		Published Spe	ecifications (V)
Range	PXI/PXIe	PCI	PXI/PXIe	PCI
0.04	±0.00024	±0.00032	±0.00032	±0.0004
0.1	±0.0002	±0.00048	±0.0005	±0.00058
0.2	±0.0004	±0.00068	±0.0008	±0.00088
0.4	±0.0008	±0.0008	±0.0014	±0.00148
1	±0.002	±0.002	±0.0032	±0.00328
2	±0.004	±0.004	±0.0062	±0.00628
4	±0.008	±.008	±0.0122	±0.01228
10	±0.02	±0.02	±0.0302	±0.03028
20	±0.04	±0.04	±0.0602	±0.06028
40	±0.08	±0.08	±0.1202	±0.12028

Vertical Gain Accuracy

Complete the following steps to verify the vertical gain accuracy of the NI 5114. You must verify both channels with each iteration listed in Table 4.

Open a session and obtain a session handle using the niScope Initialize VI.

LabVIEW VI	C/C++ Function Call
resource name instrument handle id query error out error in	Call niScope_init with the following parameters: resourceName: The device name assigned by MAX idQuery: VI_FALSE resetDevice: VI_TRUE

Configure the input impedance and the maximum input frequency using the 2. niScope Configure Chan Characteristics VI.

LabVIEW VI	C/C++ Function Call
instrument handle channel name sinput impedance max input frequency error in	Call niScope_ConfigureChan Characteristics with the following parameters: channelList: "0" inputImpedance: NISCOPE_VAL_1_MEG_OHM maxInputFrequency: The Maximum Input Frequency value in Table 4 for the current iteration

Configure the common vertical properties using the niScope Configure Vertical VI. 3.

LabVIEW VI	C/C++ Function Call
vertical coupling probe attenuation instrument handle channels vertical range vertical offset error in channel enabled	Call niScope_ConfigureVerti cal with the following parameters: coupling: NISCOPE_VAL_DC probeAttenuation: 1.0 vi: The instrument handle from niScope_init channelList: "0" range: The Range value in Table 4 for the current iteration offset: 0.0 enabled: NISCOPE_VAL_TRUE

Configure the horizontal properties using the niScope Configure Horizontal Timing VI.

	C/C++ Function Call
enforce realtime number of records instrument handle min sample rate reference position error in min record length	Call niScope_Configure HorizontalTiming with the following parameters: enforceRealtime: NISCOPE_VAL_TRUE numRecords: 1 vi: The instrument handle from niScope_init minSampleRate: 10,000,000 refPosition: 50.0 minNumPts: 100,000

Commit all the parameter settings to hardware using the niScope Commit VI.

LabVIEW VI	C/C++ Function Call
instrument handle instrument handle out	Call niScope_Commit with the following parameter: vi: The instrument handle from niScope_init

- Connect the calibrator test head directly to the channel 0 input of the device and output the Positive Input voltage in Table 6 that corresponds to the vertical range used with a 1 M Ω load impedance.
- 7. Wait 2,500 ms for the impedance matching and frequency of the calibrator to settle.
- 8. Initiate a waveform acquisition using the niScope Initiate Acquisition VI.

LabVIEW VI	C/C++ Function Call
instrument handle with the control of the control o	Call niScope_Initiate Acquisition with the following parameter: vi: The instrument handle from niScope_init

9. Fetch a waveform from the device and perform a voltage average measurement using the niScope Fetch Measurement (poly) VI. Select the Measurement Scalar DBL instance of the VI. This value is the Measured Positive Voltage used in step 14.

LabVIEW VI	C/C++ Function Call
instrument handle out channels result scalar measurement error in	Call niScope_Fetch Measurement with the following parameters: timeout: 1.0 vi: The instrument handle from niScope_init channelList: "0" scalarMeasFunction: NISCOPE_ VAL_VOLTAGE_AVERAGE

- 10. Using the calibrator, output the Negative Input voltage listed in Table 6 that corresponds to the vertical range used.
- 11. Wait 2,500 ms for the impedance matching and frequency of the calibrator to settle.
- 12. Initiate a waveform acquisition using the niScope Initiate Acquisition VI.

LabVIEW VI	C/C++ Function Call
instrument handle out	Call niScope_Initiate Acquisition with the following parameter: vi: The instrument handle from niScope_init

13. Fetch a waveform from the device and perform a voltage average measurement using the niScope Fetch Measurement (poly) VI. Select the Measurement Scalar DBL instance of the VI. This value is the Measured Negative Voltage used in step 14.

LabVIEW VI	C/C++ Function Call
instrument handle out channels result scalar measurement error in	Call niScope_Fetch Measurement with the following parameters: timeout: 1.0 vi: The instrument handle from niScope_init channelList: "0" scalarMeasFunction: NISCOPE_ VAL_VOLTAGE_AVERAGE

14. Calculate the error in the vertical gain as a percentage of input using the following formula:

$$error = \left(\left(\frac{a-b}{c-d} \right) - 1 \right) \times 100$$

where

a = the *Measured Positive Voltage*

b = the *Measured Negative Voltage*

c = the applied *Positive Voltage*

d = the applied Negative Voltage

Compare the resulting percent error to the *Published Specifications* column listed in Table 6. If the result is within the selected test limit, the device has passed this portion of the verification.

- 15. Repeat steps 2 through 14 for each iteration in Table 5.
- 16. Move the calibrator test head to the device input channel 1 and repeat steps 2 through 15 for every iteration in Table 6, changing the value of the **channelList** parameter from "0" to "1".
- 17. End the session using the niScope Close VI.

LabVIEW VI	C/C++ Function Call
instrument handle error in error out	Call niScope_close with the following parameter: vi: The instrument handle from niScope_init

Table 6. NI 5114 Vertical Gain Stimuli, Calibration Test Limits, and Published Specifications

Range (V)	Positive Input (V)	Negative Input (V)	Calibration Test Limits	Published Specifications
0.04	0.018	-0.018	±1.3975%	±1.5%
0.1	0.045	-0.045	±1.3975%	±1.5%
0.2	0.09	-0.09	±1.3975%	±1.5%
0.4	0.18	-0.18	±1.3975%	±1.5%
1	0.45	-0.45	±1.3975%	±1.5%
2	0.9	-0.9	±1.3975%	±1.5%
4	1.8	-1.8	±1.3975%	±1.5%
10	4.5	-4.5	±1.3975%	±1.5%
20	9	-9	±1.3975%	±1.5%
40	18	-18	±1.3975%	±1.5%

Programmable Vertical Offset Accuracy

Complete the following steps to verify the programmable vertical offset accuracy for each device channel.

Open a session and obtain a session handle using the niScope Initialize VI. 1.

LabVIEW VI	C/C++ Function Call
resource name instrument handle id query error out error in	Call niScope_init with the following parameters: resourceName: The device name assigned by MAX idQuery: VI_FALSE resetDevice: VI_TRUE

2. Configure the input impedance and the maximum input frequency using the niScope Configure Chan Characteristics VI.

LabVIEW VI	C/C++ Function Call
instrument handle channel name input impedance max input frequency error in	Call niScope_ConfigureChan Characteristics with the following parameters: vi: The instrument handle from niScope_init channelList: "0" inputImpedance: NISCOPE_VAL_1_MEG_OHM maxInputFrequency: 20,000,000

Configure the common vertical properties using the niScope Configure Vertical VI.

LabVIEW VI	C/C++ Function Call
vertical coupling probe attenuation instrument handle out channels vertical range vertical offset error in channel enabled	Call niScope_ConfigureVerti cal with the following parameters: coupling: NISCOPE_VAL_DC probeAttenuation: 1.0 vi: The instrument handle from niScope_init channelList: "0" range: The Range value in Table 7 for the current iteration offset: The Positive Offset setting value in Table 7 for the current iteration enabled: NISCOPE_VAL_TRUE

Configure the horizontal properties using the niScope Configure Horizontal Timing VI. 4.

LabVIEW VI	C/C++ Function Call
enforce realtime number of records instrument handle min sample rate reference position error in min record length	Call niScope_Configure HorizontalTiming with the following parameters: enforceRealtime: NISCOPE_VAL_TRUE numRecords: 1 vi: The instrument handle from niScope_init minSampleRate: 10,000,000 refPosition: 50.0 minNumPts: 100,000

5. Commit all the parameter settings to hardware using the niScope Commit VI.

LabVIEW VI	C/C++ Function Call
instrument handle out error in error out	Call niScope_Commit with the following parameter: vi: The instrument handle from niScope_init

- Connect the calibrator test head directly to the channel 0 input of the device. 6.
- Output the *Positive Output* voltage listed in Table 7 for the current iteration with a 1 M Ω 7. load impedance.
- 8. Wait 2,500 ms for the impedance matching and frequency of the calibrator to settle.
- 9. Initiate a waveform acquisition using the niScope Initiate Acquisition VI.

LabVIEW VI	C/C++ Function Call
instrument handle out error in	Call niScope_InitiateAcquisit ion with the following parameter: vi: The instrument handle from niScope_init

10. Fetch a waveform from the device and perform a voltage average measurement using the niScope Fetch Measurement (poly) VI. Select the Measurement Scalar DBL instance of the VI. This value is the Measured Positive Voltage used in step 17.

LabVIEW VI	C/C++ Function Call
instrument handle out channels channels scalar measurement error in	Call niScope_FetchMeasurem ent with the following parameters: timeout: 1.0 vi: The instrument handle from niScope_init channelList: "0" scalarMeasFunction: NISCOPE_VAL_VOLTAGE _AVERAGE

11. Configure the common vertical properties using the niScope Configure Vertical VI.

LabVIEW VI	C/C++ Function Call
vertical coupling probe attenuation instrument handle channels vertical range vertical offset error in channel enabled	Call niScope_ConfigureVertic al with the following parameters: coupling: NISCOPE_VAL_DC probeAttenuation: 1.0 vi: The instrument handle from niScope_init channelList: "0" range: The Range value in Table 7 for the current iteration offset: The Negative Offset setting in Table 7 for the current iteration enabled: NISCOPE_VAL_TRUE

12. Commit all the parameter settings to hardware using the niScope Commit VI.

LabVIEW VI	C/C++ Function Call
instrument handle ************************************	Call niScope_Commit with the following parameter: vi: The instrument handle from niScope_init

- 13. Connect the calibrator test head directly to the channel 0 input of the device and output the *Negative Offset* voltage listed in Table 7 for the current iteration with a 1 MΩ load impedance.
- 14. Wait 2,500 ms for the impedance matching and frequency of the calibrator to settle.
- 15. Initiate a waveform acquisition using the niScope Initiate Acquisition VI.

LabVIEW VI	C/C++ Function Call	
instrument handle instrument handle out	Call niScope_InitiateAcquisit ion with the following parameter: vi: The instrument handle from niScope_init	

16. Fetch a waveform from the device and perform a voltage average measurement using the niScope Fetch Measurement (poly) VI. Select the Measurement Scalar DBL instance of the VI. This value is the *Measured Negative Voltage* used in step 17.

LabVIEW VI	C/C++ Function Call
instrument handle out channels scalar measurement error in	Call niScope_FetchMeasurement with the following parameters: timeout: 1.0 vi: The instrument handle from niScope_init channelList: "0" scalarMeasFunction: NISCOPE_VAL_VOLTAGE _AVERAGE

17. Calculate the error in the programmable vertical offset as a percentage of input using the following formula:

$$error = \left(\left(\frac{a-b}{c-d} \right) - 1 \right) \times 100$$

where

a is the Measured Positive Voltage
b is the Measured Negative Voltage
c is the applied Positive Voltage
d is the applied Negative Voltage

Compare the resulting percent to the *Published Specifications* column listed in Table 7. If the result is within the selected test limit, the device has passed this portion of the verification.

- 18. Repeat steps 2 through 17 for each iteration in Table 7.
- 19. Move the calibrator test head to the device input channel 1 and repeat steps 2 through 18, changing the value of the **channelList** parameter from "0" to "1".
- 20. End the session using the niScope Close VI.

LabVIEW VI	C/C++ Function Call
instrument handle ************************************	Call niScope_close with the following parameter: vi: The instrument handle from niScope_init

Table 7. NI 5114 Programmable Vertical Offset Accuracy Stimuli, Calibration Test Limits, and Published Specifications

Iteration	Range (V)	Positive Offset (V)	Negative Offset (V)	Calibration Test Limits	Published Specifications
1	0.04	0.8	-0.8	±1.95%	±2%
2	0.1	0.8	-0.8	±1.95%	±2%
3	0.2	0.8	-0.8	±1.95%	±2%
4	0.4	0.8	-0.8	±1.95%	±2%
5	1	8	-8	±1.95%	±2%
6	2	8	-8	±1.95%	±2%
7	4	8	-8	±1.95%	±2%
8	10	30	-30	±1.95%	±2%
9	20	25	-25	±1.95%	±2%
10	40	15	-15	±1.95%	±2%

Timing Accuracy

Complete the following steps to verify the timing accuracy for the NI 5114.

Open a session and obtain a session handle using the niScope Initialize VI.

LabVIEW VI	C/C++ Function Call
resource name instrument handle id query error out error in	Call niScope_init with the following parameters: resourceName: The device name assigned by MAX idQuery: VI_FALSE resetDevice: VI_TRUE

Configure the input impedance and the maximum input frequency using the 2. niScope Configure Chan Characteristics VI.

LabVIEW VI	C/C++ Function Call
instrument handle out channel name input impedance max input frequency error in	Call niScope_ConfigureChan Characteristics with the following parameters: channelList: "0" inputImpedance: NISCOPE_VAL_50_OHM maxInputFrequency: 20,000,000

Configure the common vertical properties using the niScope Configure Vertical VI. 3.

LabVIEW VI	C/C++ Function Call
vertical coupling probe attenuation instrument handle channels vertical range vertical offset error in channel enabled	Call niScope_Configure Vertical with the following parameters: coupling: NISCOPE_VAL_DC probeAttenuation: 1.0 vi: The instrument handle from niScope_init channelList: "0" range: 2.0 offset: 0.0 enabled: NISCOPE_VAL_TRUE

Configure the horizontal properties using the niScope Configure Horizontal Timing VI.

LabVIEW VI	C/C++ Function Call
enforce realtime number of records instrument handle min sample rate reference position error in min record length	Call niScope_Configure HorizontalTiming with the following parameters: enforceRealtime: NISCOPE_VAL_TRUE numRecords: 1 vi: The instrument handle from niScope_init minSampleRate: 250,000,000 refPosition: 50.0 minNumPts: 2,500,000

Commit all the parameter settings to hardware using the niScope Commit VI.

LabVIEW VI	C/C++ Function Call
instrument handle instrument handle out	Call niScope_Commit with the following parameter: vi: The instrument handle from niScope_init

- Connect the scope calibrator test head directly to the channel 0 input of the device. 6. Configure the calibrator to output an exact 11 MHz sine wave with 1 V_{pk-pk} amplitude and 50Ω load impedance.
- Wait 2,500 ms for the impedance matching and frequency of the calibrator to settle. 7.
- Initiate a waveform acquisition using the niScope Initiate Acquisition VI.

LabVIEW VI	C/C++ Function Call
instrument handle out	Call niScope_Initiate Acquisition with the following parameter: vi: The instrument handle from niScope_init

9. Retrieve a waveform using the niScope Fetch (poly) VI. Select the Array Measurement 1D DBL instance of the VI. Use the default value for the **timestamp Type** parameter.

LabVIEW VI	C/C++ Function Call
instrument handle out channels meas wfm info array measurement error in meas waveform size	Call niScope_Fetch Measurement with the following parameters: timeout: 5.0 vi: The instrument handle from niScope_init channelList: "0" numSamples: -1

- 10. Measure the exact frequency of the peak around 11 MHz using the Extract Single Tone Information VI with the following inputs.
 - advanced search»approx freq.: -1
 - advanced search»search: 5
 - export signals: 0 (none)

LabVIEW VI	C/C++ Function Call
time signal in detected frequency export mode error in (no error) advanced search error out measurement info	Perform an FFT on the array of data from step 9.

11. Calculate the error in timing as parts per million (ppm) using the following formula:

error =
$$(a - 11,000,000) / 11$$

where a is the measured frequency.

Compare the result to the *Published Specifications* column listed in Table 8. If the result is within the selected test limit, the device has passed this portion of the verification.



Note The same time source is used for both channel 0 and channel 1, so you only need to verify the timing accuracy on one channel.

12. End the session using the niScope Close VI.

LabVIEW VI	C/C++ Function Call
instrument handle ************************************	Call niScope_close with the following parameter: vi: The instrument handle from niScope_init

Table 8. NI 5114 Timing Accuracy Limits and Published Specifications

Calibration Test Limits	Published Specifications
±5.3 ppm	±25 ppm

Bandwidth and Flatness

Complete the following steps to verify the bandwidth and flatness of the NI 5114. You must verify both channels with each iteration listed in Table 9.



Note Verification of bandwidth is optional.

Open a session and obtain a session handle using the niScope Initialize VI.

LabVIEW VI	C/C++ Function Call
resource name instrument handle id query error out error in	Call niScope_init with the following parameters: resourceName: The device name assigned by MAX idQuery: VI_FALSE resetDevice: VI_TRUE

Configure the input impedance and the maximum input frequency using the 2. niScope Configure Chan Characteristics VI.

LabVIEW VI	C/C++ Function Call
instrument handle cottenance input impedance error in instrument handle out error out	Call niScope_ConfigureChan Characteristics with the following parameters: vi: The instrument handle from niScope_init channelList: "0" inputImpedance: NISCOPE_VAL_50_OHM
	maxInputFrequency: The Maximum Input Frequency value in Table 9 for the current iteration

3. Configure the common vertical properties using the niScope Configure Vertical VI.

LabVIEW VI	C/C++ Function Call
vertical coupling probe attenuation instrument handle out channel name vertical range vertical offset error in channel enabled instrument handle out vertical offset error in channel enabled	Call niScope_Configure Vertical with the following parameters: coupling: NISCOPE_VAL_DC probeAttenuation: 1.0 vi: The instrument handle from niScope_init channelList: "0" range: The Range value in Table 9 for the current iteration offset: 0.0 enabled: NISCOPE_VAL_TRUE

Configure the horizontal properties using the niScope Configure Horizontal Timing VI.

LabVIEW VI	C/C++ Function Call
enforce realtime number of records instrument handle min sample rate reference position error in min record length	Call niScope_Configure HorizontalTiming with the following parameters: enforceRealtime: NISCOPE_VAL_TRUE numRecords: 1 vi: The instrument handle from niScope_init minSampleRate: 10,000,000 refPosition: 50.0 minNumPts: 30,000

5. Commit all the parameter settings to hardware using the niScope Commit VI.

LabVIEW VI	C/C++ Function Call
instrument handle was instrument handle out	Call niScope_Commit with the following parameter: vi: The instrument handle from niScope_init

- Connect the calibrator test head directly to the channel 0 input of the device. Configure the calibrator to output a 50 kHz sine wave with peak-to-peak voltage amplitude set to half the vertical range of the device. Configure the load impedance of the calibrator to match the input impedance of the device.
- Wait 2,500 ms for the impedance matching and frequency of the calibrator to settle. 7.
- Initiate a waveform acquisition using the niScope Initiate Acquisition VI.

LabVIEW VI	C/C++ Function Call
resource name id query reset device error in	Call niScope_InitiateAcquisit ion with the following parameter: vi: The instrument handle from niScope_init

Fetch a waveform from the device and perform a voltage RMS measurement using the niScope Fetch (poly) Measurement VI. Select the Measurement Scalar DBL instance of the VI. This value is the Measured RMS Voltage of 50 kHz Sine Wave used in step 11.e.

LabVIEW VI	C/C++ Function Call
instrument handle out channels result scalar measurement error in	Call niScope_Fetch Measurement with the following parameters: timeout: 1.0 vi: The instrument handle from niScope_init channelList: "0" scalarMeasFunction: NISCOPE_VAL_VOLTAGE_R MS

10. Configure the horizontal properties using the niScope Configure Horizontal Timing VI.

LabVIEW VI	C/C++ Function Call
enforce realtime number of records instrument handle with sample rate reference position error in min record length	Call niScope_Configure HorizontalTiming with the following parameters: enforceRealtime: NISCOPE_VAL_TRUE numRecords: 1 vi: The instrument handle from niScope_init minSampleRate: 250,000,000 refPosition: 50.0 minNumPts: 300,000

- 11. Repeat steps 11. a through 11. e for each *Input Frequency* in the current iteration.
 - Configure the calibrator to output the *Input Frequency* listed in Table 9 for the current iteration.
 - Wait 2,500 ms for the impedance matching and frequency of the calibrator to settle. b.
 - c. Initiate a waveform acquisition using the niScope Initiate Acquisition VI.

LabVIEW VI	C/C++ Function Call
instrument handle instrument handle out	Call niScope_Initiate Acquisition with the following parameter: vi: The instrument handle from niScope_init

Fetch a waveform from the device and perform a voltage RMS measurement using the niScope Fetch Measurement (poly) VI. Select the Measurement Scalar DBL instance of the VI. This value is the Measured RMS Voltage of Generated Sine Wave used in step 11. e.

LabVIEW VI	C/C++ Function Call
instrument handle out channels scalar measurement error in	Call niScope_FetchMeasureme nt with the following parameters: timeout: 1.0 vi: The instrument handle from niScope_init channelList: "0" scalarMeasFunction: NISCOPE_VAL_VOLTAGE_RM S

Calculate the power difference using the following formula: e.

power =
$$(20\log_{10} a) - (20\log_{10} b)$$

where

a is the Measured RMS Voltage of Generated Sine Wave

b is the Measured RMS Voltage of 50 kHz Sine Wave

If the result is within the test limits in Table 9, the device has passed this portion of the verification.

- 12. Repeat steps 2 through 11 for each iteration in Table 9.
- 13. Move the calibrator test head to the device input channel 1 and repeat steps 2 through 12, changing the value of the **channelList** parameter from "0" to "1".

14. End the session using the niScope Close VI.

LabVIEW VI	C/C++ Function Call
instrument handle ************************************	Call niScope_close with the following parameter: vi: The instrument handle from niScope_init

Table 9. NI 5114 Bandwidth and Flatness Stimuli and Published Specifications

	Max Input				shed cations
Iteration	Frequency (MHz)	Range (V)	Input Frequency (MHz)	Max Level (dB)	Min Level (dB)
1	125	0.04	50.1	1	-1
			100.1	3	-3
2	125	0.4	50.1	1	-1
			125.1	3	-3
3	125	2	50.1	1	-1
			125.1	3	-3
4	125	10	50.1	1	-1
			125.1	3	-3
5	20	1	20.1	N/A	-3*
			25.1	-3*	N/A

^{*} Published specification value listed for validation of noise filter only. The specification is not included in the NI PXIe-5114 Specifications document. Verification of these limits is optional.

Trigger Sensitivity

Complete the following steps to verify the trigger sensitivity of the NI 5114. You must verify channel 0, channel 1, and the external trigger channel using the corresponding iterations listed in Table 10. Use the following inputs:

- For channel 0, use the entries for iterations 1 and 2.
- For channel 1, use the entries for iterations 3 and 4.
- For the external trigger channel, use the entries for iterations 5 and 6.

1. Open a session and obtain a session handle using the niScope Initialize VI.

LabVIEW VI	C/C++ Function Call
resource name instrument handle id query error out error in	Call niScope_init with the following parameters: resourceName: The device name assigned by MAX idQuery: VI_FALSE resetDevice: VI_TRUE

Configure the input impedance and the maximum input frequency using the niScope Configure Chan Characteristics VI.

LabVIEW VI	C/C++ Function Call
instrument handle out channels ainput impedance max input frequency error in	Call niScope_ConfigureChan Characteristics with the following parameters: vi: The instrument handle from niScope_init channelList: "0" inputImpedance: NISCOPE_VAL_50_OHM maxInputFrequency: 125,000,000

Configure the common vertical properties using the niScope Configure Vertical VI. 3.

LabVIEW VI	C/C++ Function Call
vertical coupling probe attenuation instrument handle channel name vertical range vertical offset error in channel enabled	Call niScope_Configure Vertical with the following parameters: coupling: NISCOPE_VAL_DC probeAttenuation: 1.0 vi: The instrument handle from niScope_init channelList: "0" range: 0.2 offset: 0.0 enabled: NISCOPE_VAL_TRUE

Configure the horizontal properties using the niScope Configure Horizontal Timing VI. 4.

LabVIEW VI	C/C++ Function Call
enforce realtime number of records instrument handle min sample rate reference position error in min record length	Call niScope_Configure HorizontalTiming with the following parameters: enforceRealtime: NISCOPE_VAL_TRUE numRecords: 50 vi: The instrument handle from niScope_init minSampleRate: 250,000,000 refPosition: 50.0 minNumPts: 1,000

Configure an edge trigger using the niScope Configure Trigger (poly) VI. Select the Analog Edge Ref Trigger instance of the VI.

LabVIEW VI	C/C++ Function Call
	Call niScope_Configure TriggerEdge with the following parameters:
trigger coupling trigger slope instrument handle trigger source (Channel 0) trigger level error in trigger holdoff trigger delay	triggerCoupling: NISCOPE_VAL_DC slope: The Slope value in Table 10 for the current iteration vi: The instrument handle from niScope_init triggerSource: The Trigger Source value in Table 10 for the current iteration level: The Level value in Table 10 for the current iteration holdoff: 0 delay: 0



Note The trigger level is set to center the trigger hysteresis window at 0.0 V.

Commit all the parameter settings to hardware using the niScope Commit VI.

LabVIEW VI	C/C++ Function Call
instrument handle instrument handle out	Call niScope_Commit with the following parameter: vi: The instrument handle from niScope_init

- Connect the scope calibrator test head directly to the device input for the channel you are testing. Configure the calibrator to output the appropriate signal in Table 10.
- 8. Wait 2,500 ms for the impedance matching and frequency of the calibrator to settle.
- 9. Initiate a waveform acquisition using the niScope Initiate Acquisition VI.

LabVIEW VI	C/C++ Function Call
instrument handle out	Call niScope_Initiate Acquisition with the following parameter: vi: The instrument handle from niScope_init

10. Acquire a waveform using the niScope Fetch (poly) VI. Select the Cluster instance of the VI.

LabVIEW VI	C/C++ Function Call
instrument handle out channels wfm info numSamples error in	Call niScope_Fetch with the following parameter: timeout: 2.0 vi: The instrument handle from niScope_init channelList: "0" numSamples: -1

11. If the device does not time out, the device has passed this portion of the verification. If the device does time out, you must call the niScope Abort VI to end the acquisition. If your device fails and you end the acquisition, you must re-run the verification.

LabVIEW VI	C/C++ Function Call
instrument handle out	Call niScope_Abort with the following parameter: vi: The instrument handle from niScope_init

- 12. To verify the trigger sensitivity on channel 1, repeat steps 2 through 11 using the values in Table 10, iterations 3 and 4. Make the following changes:
 - Change **channelList** to "1" in steps 2, 3, and 10.
 - Connect the calibrator test head to channel 1 in step 7.
- 13. To verify the trigger sensitivity on the external trigger channel, repeat steps 2 through 11 using the values in Table 10, iterations 5 and 6. Make the following changes:
 - Change **channelList** to "0" in steps 2, 3, and 10.
 - Connect the calibrator test head to the external trigger channel (TRIG) in step 7.
- 14. End the session using the niScope Close VI.

LabVIEW VI	C/C++ Function Call
instrument handle ************************************	Call niScope_close with the following parameter: vi: The instrument handle from niScope_init

Table 10. NI 5114 Trigger Sensitivity Inputs

Iteration	Trigger Source	Level	Slope	Calibrator Signal	
1	0	1 mV	NISCOPE_VAL_POSITIVE	9.7 mV _{pk-pk}	
2	0	-1 mV	NISCOPE_VAL_NEGATIVE	100 MHz sine wave with 50 Ω load impedance	
3	1	1 mV	NISCOPE_VAL_POSITIVE	$9.7 \text{ mV}_{\text{pk-pk}}$	
4	1	-1 mV	NISCOPE_VAL_NEGATIVE	100 MHz sine wave with 50 Ω load impedance	
5	VAL_EXTERNAL	50 mV	NISCOPE_VAL_POSITIVE	485 mV _{pk-pk}	
6	VAL_EXTERNAL	-50 mV	NISCOPE_VAL_NEGATIVE	125 MHz sine wave with 1 MΩ load impedance	

Adjustment

If the NI 5114 successfully passed each of the verification procedures within the calibration test limits, then an adjustment is recommended but not required to guarantee the published specifications for the next two years. You can update the calibration date and onboard calibration temperature without making any adjustments by completing only steps 1 and 13.f in this section. If the device was not within the calibration test limits for each of the verification procedures, you can perform the adjustment procedure to improve the accuracy of the device. Refer to the Appendix A: Calibration section to determine which procedures to perform.

An adjustment is required only once every two years. Following the adjustment procedure automatically updates the calibration date and temperature in the EEPROM of the device.

Complete all of the following steps to externally adjust the NI 5114:

Obtain an instrument session handle using the niScope Cal Start VI.

LabVIEW VI	C/C++ Function Call
	Call niScope_CalStart with the following parameters:
resource name Start instrument handle password error in	resourceName: The name of the device to calibrate. You can find this name under Devices and Interfaces in MAX. password: The password required to open an external calibration session. If this password has not been changed since manufacturing, the password is "NI".

- 2. Short-circuit the channel 0 input of the device by connecting the calibrator test head directly to the device and grounding the output of the calibrator.
- Wait 2,500 ms for the impedance matching and frequency of the calibrator to settle. 3.

4. Adjust the vertical range using the niScope Cal Adjust Range VI.

LabVIEW VI	C/C++ Function Call
instrument handle out channels range (V) stimulus error in	Call niScope_CalAdjust Range with the following parameters: sessionHandle: The instrument handle from niScope_CalStart channelName: "0" range: 10 stimulus: 0

- 5. Configure the calibrator to output the voltage listed under the *Input (V)* column in Table 11. Configure the load impedance of the calibrator to $1 \text{ M}\Omega$.
- 6. Wait 2,500 ms for the impedance matching and frequency of the calibrator to settle.
- 7. Adjust the vertical range using the niScope Cal Adjust Range VI.

LabVIEW VI	C/C++ Function Call
instrument handle channels channels range (V) stimulus error in	Call niScope_CalAdjust Range with the following parameters: sessionHandle: The instrument handle from niScope_CalStart channelName: "0" range: The Range value in Table 11 for the current iteration stimulus: The Input voltage in Table 11 for the current iteration

- 8. Repeat steps 5 through 7 for each iteration in Table 11.
- 9. Move the calibrator test head to the device input channel 1 and repeat steps 2 through 8, changing the value of the **channelList** parameter from "0" to "1".
- 10. Using a BNC cable, connect REF FREQUENCY OUTPUT on the back of the calibrator to the channel 0 input of the device. Make sure the output of the reference frequency is enabled and set to 10 MHz. If you are not using a Fluke 9500B/Wavetek 9500 calibrator, connect a precise 10 MHz, 1 Vpk-pk sine or square wave source to channel 0.

11. Adjust the sample rate using the niScope Cal Adjust VCXO VI.

LabVIEW VI	C/C++ Function Call
instrument handle Adjust Stimulus frequency (Hz) Adjust VCXO error in	Call niScope_Cal AdjustVCXO with the following parameters: sessionHandle: The instrument handle from niScope_CalStart stimulusFreq: 10,000,000



Note The 10 MHz stimulus is automatically taken from channel 0.

- 12. Disconnect or disable all inputs to the device.
- 13. Self-calibrate the device using niScope Cal Self Calibrate VI.

LabVIEW VI	C/C++ Function Call
instrument handle out channels Option error in	Call niScope_CalSelf Calibrate with the following parameters: sessionHandle: The instrument handle from niScope_CalStart channelList: VI_NULL option: VI_NULL

End the session and save the results using the niScope Cal End VI. f.

LabVIEW VI	C/C++ Function Call
instrument handle END error out	Call niScope_CalEnd with the following parameters: sessionHandle: The instrument handle from niScope_CalStart action: NISCOPE_VAL_ACTION_STORE

You have finished adjusting the NI 5114. Repeat the steps listed in the Verification section to reverify the performance of the NI 5114 after adjustments.

Table 11. NI 5114 Input Parameters for External Adjustment

Iteration	Range (V)	Input (V)
1	40	18
2	20	9
3	10	4.5
4	4	1.8
5	2	0.9
6	1	0.45
7	0.4	0.18
8	0.2	0.09
9	0.1	0.045
10	0.04	0.018
11	40	-18
12	20	-9
13	10	-4.5
14	4	-1.8
15	2	-0.9
16	1	-0.45
17	0.4	-0.18
18	0.2	-0.09
19	0.1	-0.045
20	0.04	-0.018

Appendix A: Calibration

External calibration involves verification and, if necessary, adjustment and reverification. Adjustment is the process of measuring and compensating for device performance to improve the measurement accuracy. Performing an adjustment updates the calibration date, effectively resetting the calibration interval. The device is guaranteed to meet or exceed its published specifications for the duration of the calibration interval. Verification is the process of testing the device to ensure that the measurement accuracy is within certain specifications. Verification can be used to ensure that the adjustment process was successful or to determine if the adjustment process needs to be performed at all. During verification, you must compare the measurement error to the limits given in each section.


This document provides two sets of test limits for most verification stages—the *calibration test* limits and the published specifications. The calibration test limits are more restrictive than the published specifications. If all of the measurement errors determined during verification fall within the calibration test limits, the device is guaranteed to meet or exceed its published specifications for a full calibration interval (two years). For this reason, you must verify against the calibration test limits when performing verification after adjustment. If all of the measurement errors determined during verification fall within the published specifications, but not within the calibration test limits, the device is meeting its published specifications. While the device does not necessarily remain within these specifications for an additional two years, it will meet published specifications for the remainder of the current calibration interval. In this case, you can perform an adjustment if you want to further improve the measurement accuracy or reset the calibration interval. If some measurement errors determined during verification do not fall within the published specifications, you must perform an adjustment to restore the device operation to its published specifications.

The Complete Calibration section describes the recommended calibration procedure.

Complete Calibration

Perform a complete calibration to guarantee that the NI 5114 meets or exceeds its published specifications for a two-year calibration interval. At the end of the complete calibration procedure, verify that the measurement error falls within the calibration test limits. Figure 1 shows the programming flow for a complete calibration.

Figure 1. Complete Calibration Programming Flow

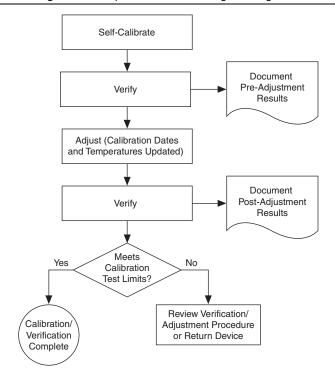

Appendix B: Calibration Utilities

NI-SCOPE supports several calibration utilities you can use to retrieve information about adjustments performed on the NI 5114, change the external calibration password, and store small amounts of information in the onboard EEPROM. Although you can retrieve some data using MAX, you can retrieve all the data programmatically using NI-SCOPE functions.

MAX

To retrieve data using MAX, complete the following steps:

- Select the device from which you want to retrieve information from My System»Devices and Interfaces.
- 2. Select the Settings tab in the lower left corner.

You should see information about the last date and temperature for both external and self-calibration

NI-SCOPE

NI-SCOPE provides a full complement of calibration utility functions and VIs. Refer to the *NI High-Speed Digitizers Help* for the complete function reference and VI reference. The utility functions include:

- niScope_CalChangePassword (niScope Cal Change Password VI)
- niScope_CalFetchCount (niScope Cal Fetch Count VI)
- niScope_CalFetchDate (niScope Cal Fetch Date VI)
- niScope_CalFetchMiscInfo (niScope Cal Fetch Misc Info VI)
- niScope_CalFetchTemperature (niScope Cal Fetch Temperature VI)
- niScope_CalStoreMiscInfo (niScope Cal Store Misc Info VI)

Where to Go for Support

The National Instruments website is your complete resource for technical support. At ni.com/support you have access to everything from troubleshooting and application development self-help resources to email and phone assistance from NI Application Engineers.

Visit ni.com/services for NI Factory Installation Services, repairs, extended warranty, and other services

Visit ni.com/register to register your National Instruments product. Product registration facilitates technical support and ensures that you receive important information updates from NI.

A Declaration of Conformity (DoC) is our claim of compliance with the Council of the European Communities using the manufacturer's declaration of conformity. This system affords the user protection for electromagnetic compatibility (EMC) and product safety. You can obtain the DoC for your product by visiting ni.com/certification. If your product supports calibration, you can obtain the calibration certificate for your product at ni.com/calibration.

National Instruments corporate headquarters is located at 11500 North Mopac Expressway, Austin, Texas, 78759-3504. National Instruments also has offices located around the world. For telephone support in the United States, create your service request at ni.com/support or dial 512 795 8248. For telephone support outside the United States, visit the Worldwide Offices section of ni.com/niglobal to access the branch office websites, which provide up-to-date contact information, support phone numbers, email addresses, and current events.

Refer to the NI Trademarks and Logo Guidelines at ni.com/trademarks for more information on National Instruments trademarks. Other product and company names mentioned herein are trademarks or trade names of their respective companies. For patents covering National Instruments products/technology, refer to the appropriate location: Help-Patents in your software, the patents.txt file on your media, or the National Instruments Patents Notice at ni.com/patents. You can find information about end-user license agreements (EULAs) and third-party legal notices in the readme file for your NI product. Refer to the Export Compliance Information at ni.com/legal/export-compliance for the National Instruments global trade compliance policy and how to obtain relevant HTS codes, ECCNs, and other import/export data. NI MAKES NO EXPRESS OR IMPLIED WARRANTIES AS TO THE ACCURACY OF THE INFORMATION CONTAINED HEREIN AND SHALL NOT BE LIABLE FOR ANY ERRORS. U.S. Government Customers: The data contained in this manual was developed at private expense and is subject to the applicable limited rights and restricted data rights as set forth in FAR 52.227-14, DFAR 252.227-7014, and DFAR 252.227-7015.

© 2014 National Instruments, All rights reserved.

374380A-01 Aug14