

COMPREHENSIVE SERVICES

We offer competitive repair and calibration services, as well as easily accessible documentation and free downloadable resources.

SELL YOUR SURPLUS

We buy new, used, decommissioned, and surplus parts from every NI series. We work out the best solution to suit your individual needs.

 Sell For Cash  Get Credit  Receive a Trade-In Deal

OBSOLETE NI HARDWARE IN STOCK & READY TO SHIP

We stock **New, New Surplus, Refurbished, and Reconditioned** NI Hardware.



Bridging the gap between the manufacturer and your legacy test system.

 1-800-915-6216

 www.apexwaves.com

 sales@apexwaves.com

All trademarks, brands, and brand names are the property of their respective owners.

Request a Quote

 **CLICK HERE**

NI-9213

NI 9213 Calibration Procedure

[Français](#) [Deutsch](#) [日本語](#) [한국어](#) [简体中文](#)

ni.com/manuals

This document contains information about calibrating National Instruments 9213 modules using NI-DAQmx. This calibration procedure is intended for metrology labs.

This document does not discuss programming techniques or compiler configuration. The NI-DAQmx driver contains online help files that have compiler-specific instructions and detailed function explanations. You can install these help files when you install NI-DAQmx on the calibration computer.

Contents

Conventions	2
Software	2
Documentation	3
Calibration Interval	3
Test Equipment	4
Test Conditions	4
Calibration Procedure	5
Calibration Process Overview	5
Initial Setup	5
Verification Procedure	6
Analog Input Gain Verification	6
Analog Input Offset Verification	10
Specifications	14
Test Limits	14
Range	14
Test Point	14
1-Year Limits	14
Where to Go for Support	16

Conventions

The following conventions appear in this manual:

» The » symbol leads you through nested menu items and dialog box options to a final action. The sequence **File»Page Setup»Options** directs you to pull down the **File** menu, select the **Page Setup** item, and select **Options** from the last dialog box.



This icon denotes a note, which alerts you to important information.

bold Bold text denotes items that you must select or click in the software, such as menu items and dialog box options. Bold text also denotes parameter names and hardware labels.

italic Italic text denotes variables, emphasis, a cross-reference, or an introduction to a key concept. Italic text also denotes text that is a placeholder for a word or value that you must supply.

monospace Monospace text denotes text or characters that you should enter from the keyboard, sections of code, programming examples, and syntax examples. This font is also used for the proper names of disk drives, paths, directories, programs, subprograms, subroutines, device names, functions, operations, variables, filenames, and extensions.

monospace italic Italic text in this font denotes text that is a placeholder for a word or value that you must supply.

Software

Install NI-DAQmx 8.9.5 or later on the calibration computer. NI-DAQmx includes high-level function calls to simplify the task of writing software to calibrate devices. You must have the proper device driver installed on the calibration system before calibrating the device.



Note NI recommends that you install the NI-DAQmx driver software before physically installing the NI 9213. NI-DAQmx, available at ni.com/downloads, configures and controls the NI 9213.

NI-DAQmx supports a number of programming languages, including LabVIEW, LabWindows™/CVI™, Microsoft Visual C++ 6.0, Microsoft Visual Basic 6.0, Microsoft .NET, and Borland C++.

You can access the NI-DAQmx header file, `NIDAQmx.h`, like any standard library. You can find examples of how to use the NI-DAQmx driver in the `Program Files\National Instruments\NI-DAQ\Examples` directory.

Documentation

You might find the following documentation helpful as you write the calibration procedure:

- *NI-DAQmx Help*—This help file contains general information about measurement concepts, key NI-DAQmx concepts, and common applications that apply to all programming environments. To access this help file, select **Start»All Programs»National Instruments»NI-DAQ»NI-DAQmx Help**.
- *NI-DAQmx C Reference Help*—This help file contains C reference and general information about measurement concepts. To access this help file, select **Start»All Programs»National Instruments»NI-DAQ»NI-DAQmx C Reference Help**.
- *DAQ Getting Started Guide* for NI-DAQ 8.0 or later—This guide describes how to install NI-DAQmx for Windows software and NI-DAQmx-supported DAQ devices, and how to confirm that your device is operating properly. To access this guide, select **Start»All Programs»National Instruments»NI-DAQ»DAQ Getting Started Guide**.



Note The documents above are installed with NI-DAQmx. You can also download the latest versions from the NI Web site at ni.com/manuals.

- *NI 9213 Operating Instructions and Specifications*—This document describes how to use the NI 9213 and include specifications and terminal assignments for the NI 9213. The limits you use to verify the accuracy of the device are based on the specifications found in this document. You can download the latest version of this document from the NI Web site at ni.com/manuals.

Calibration Interval

The NI 9213 should be calibrated at a regular interval as defined by the measurement accuracy requirements of your application. National Instruments recommends that you routinely perform a complete calibration at least once every year. You can shorten this interval based on the accuracy demands of your application or requirements of your processes.

Test Equipment

National Instruments recommends that you use the following equipment for calibrating the NI 9213.

Table 1. Recommended Equipment

Equipment	Recommended Model	Requirements
Calibrator	Fluke 5520A using the 3.3 V range*	If this instrument is unavailable, use a high-precision voltage source with an accuracy of at least 40 ppm and an output impedance of less than or equal to 3.125 Ω .†
Chassis	NI cDAQ-9172	—

* Because the 3.3 V range has a low output impedance.
† This output impedance assumes 16 channels are connected to the calibrator. If you are connecting less than 16 channels to the calibrator, you can calculate the output impedance for the calibrator using the following equation:
$$CalOutMax = (50 \Omega / Ch) - R_{lead}$$
where $CalOutMax$ is the maximum calibrator output impedance allowed to properly calibrate the NI 9213
 Ch is the number of channels connected to the calibrator
 R_{lead} is the resistance of the cable connecting the calibrator to the NI 9213

Test Conditions

Follow these guidelines to optimize the connections and the environment:

- Keep connections to the device as short as possible. Long cables and wires act as antennae, picking up extra noise that can affect measurements.
- Use shielded copper wire for all cable connections to the device. Use twisted-pair wire to eliminate noise and thermal offsets.
- Maintain an ambient temperature of 23 ± 10 °C. The device temperature will be greater than the ambient temperature.
- Keep relative humidity below 80%.
- Allow a warm-up time of 15 minutes to ensure that the measurement circuitry is at a stable operating temperature.

Calibration Procedure

This section provides instructions for verifying the performance of the NI 9213.

Calibration Process Overview

The calibration process consists of the following steps:

1. *Initial Setup*—Configure the device in NI-DAQmx.
2. *Verification Procedure*—Verify the existing operation of the device. This step confirms whether the device is operating within its specified range and whether it needs adjustment.
3. *Adjustment*—If the device does not fall within the desired specifications, submit the device to NI for a factory calibration to adjust the calibration constants.
4. *Verification Procedure*—Perform another verification to ensure that the device operates within its specifications after adjustment.

The first two steps are explained in the following sections.

Initial Setup

You must configure the device in Measurement & Automation Explorer (MAX) to communicate with NI-DAQmx.

Complete the following steps to configure a device in MAX:

1. Install the NI-DAQmx driver software.
2. Make sure that no power is connected to the module terminals. If the system is in a nonhazardous location, the chassis power can be on when you install the module.
3. Insert the module into an available slot in the cDAQ-9172 chassis.
4. Launch MAX.
5. Right-click the device name and select **Self-Test** to ensure that the device is working properly.



Note When a device is configured with MAX, it is assigned a device name. Each function call uses this device name to determine which DAQ device to calibrate. This document uses `dev1` to refer to the device name. In the following procedures, use the device name as it appears in MAX.

Verification Procedure

Verification determines how well the device is meeting its specifications. By completing this procedure, you can see how the device has drifted over time, which helps you determine the appropriate calibration interval for your application. Tables 3 and 4 in the *Test Limits* section show all acceptable settings for the device type. Throughout the verification process, use Tables 3 and 4 to determine if the device is operating within its specified range. You must perform verification on all analog input channels.

Analog Input Gain Verification

Complete the following steps to test the performance of the analog input gain of the device:

1. Connect the LO output of the calibrator to all negative terminals of the NI 9213, then connect the HI output of the calibrator to all positive terminals. Refer to Figure 1 for the terminal assignments of the NI 9213.

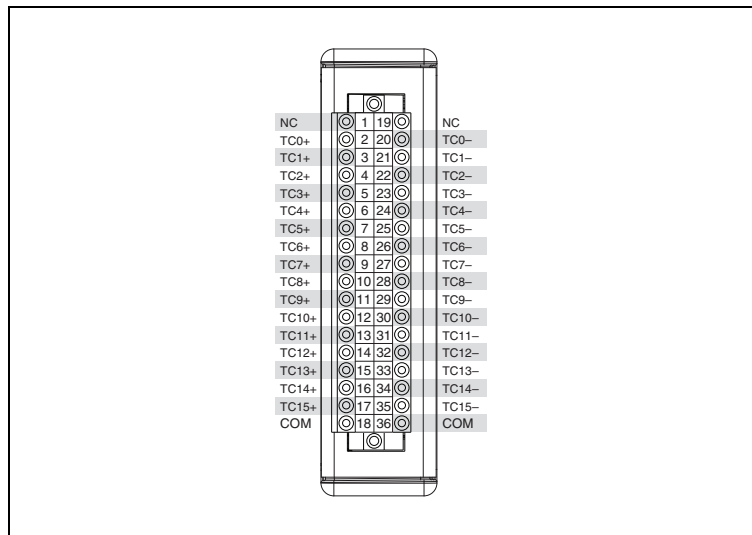


Figure 1. NI 9213 Terminal Assignments

2. When using the Fluke 5520A, lock the calibrator range to 3.3 V to maintain a low output impedance.
3. Set the calibrator voltage to a Test Point value indicated in Table 3.

- If you use C function calls, create a task using `DAQmxCreateTask`, as shown in the following table. If you use LabVIEW, skip this step. The task is created in step 5 in LabVIEW.

LabVIEW Block Diagram	NI-DAQmx Function Call
LabVIEW does not require this step.	Call <code>DAQmxCreateTask</code> with the following parameters: taskName: <code>AIVerificationTask</code> taskHandle: <code>&taskHandle</code>

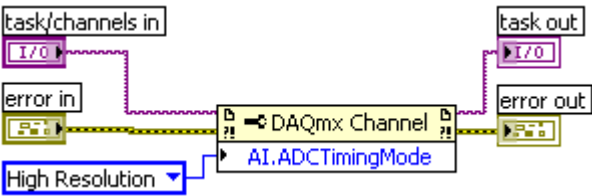
- Create and configure an AI voltage channel using the DAQmx Create Virtual Channel VI, as shown in the following table.



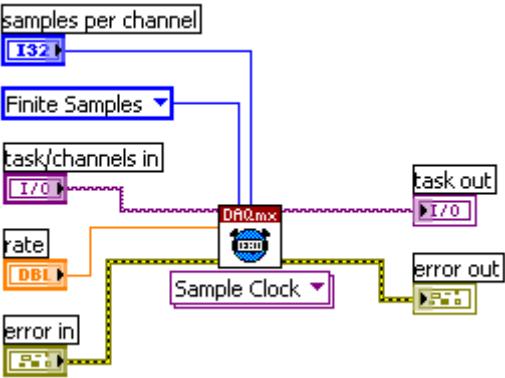
Note Throughout the procedure, refer to the NI-DAQmx function parameters for the LabVIEW input values. Refer to the block diagram images for the correct instance to use for polymorphic VIs.

LabVIEW Block Diagram	NI-DAQmx Function Call
	Call <code>DAQmxCreateAIVoltageChan</code> with the following parameters: taskHandle: <code>taskHandle</code> physicalChannel: <code>dev1/aiX*</code> nameToAssignToChannel: <code>myVoltageChannel</code> terminalConfig: <code>DAQmx_Val_Cfg_Default</code> minVal: <code>-0.078125</code> maxVal: <code>0.078125</code> units: <code>DAQmx_Val_Volts</code> customScaleName: <code>NULL</code>
* X refers to the channel number.	

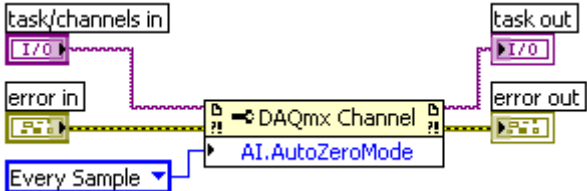
- Set the timing mode using the DAQmx Channel Property Node, as shown in the following table. Use Table 3 to determine when to set the timing mode to High Resolution or High Speed.

LabVIEW Block Diagram	NI-DAQmx Function Call
 <p>The diagram shows a DAQmx Channel block with an AI.ADCTimingMode property node. The property node is set to 'High Resolution'. The DAQmx Channel block is connected to task channels in/out and error in/out nodes.</p>	<p>Call DAQmxSetChanAttribute with the following parameters:</p> <p>taskHandle: taskHandle</p> <p>Attribute: DAQmx_AI_ADCTimingMode</p> <p>Value: DAQmx_Val_HighResolution or DAQmx_Val_HighSpeed</p>


- Configure the timing properties for the voltage acquisition using the DAQmx Timing VI, as shown in the following table.

LabVIEW Block Diagram	NI-DAQmx Function Call
 <p>The diagram shows a DAQmx Timing VI block. It is configured with 'samples per channel' set to 132, 'Finite Samples' selected, 'rate' set to 100, and 'Sample Clock' selected. The VI is connected to task channels in/out and error in/out nodes.</p>	<p>Call DAQmxCfgSampClkTiming with the following parameters:</p> <p>taskHandle: taskHandle</p> <p>source: NULL</p> <p>rate: 8.9 (High Resolution), 100 (High Speed)</p> <p>activeEdge: DAQmx_Val_Rising</p> <p>sampleMode: DAQmx_Val_FiniteSamps</p> <p>sampsPerChan: 50 (High Resolution), 200 (High Speed)</p>

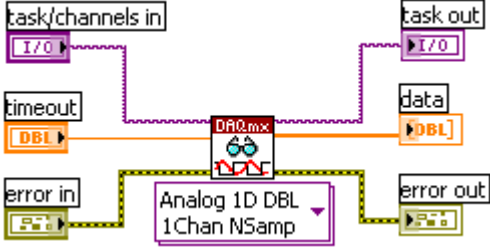
- Enable autozero using the DAQmx Channel Property Node, as shown in the following table.

LabVIEW Block Diagram	NI-DAQmx Function Call
	<p>Call DAQmxSetChanAttribute with the following parameters:</p> <p>taskHandle: taskHandle Attribute: DAQmx_AI_AutoZeroMode Value (Autozero on): DAQmx_Val_EverySample</p>


- Start the acquisition using the DAQmx Start Task VI, as shown in the following table.

LabVIEW Block Diagram	NI-DAQmx Function Call
	<p>Call DAQmxStartTask with the following parameter:</p> <p>taskHandle: taskHandle</p>

- Acquire the voltage data using the DAQmx Read VI, as shown in the following table.

LabVIEW Block Diagram	NI-DAQmx Function Call
	<p>Call DAQmxReadAnalogF64 with the following parameters:</p> <p>taskHandle: taskHandle numSampsPerChan: -1 timeout: 10.0 fillMode: DAQmx_Val_GroupByChannel readArray: data arraySizeInSamples: 50 (High Resolution), 200 (High Speed) sampsPerChanRead: &read reserved: NULL</p>

11. Average the voltage values that you acquired. Compare the resulting average to the Upper Limit and Lower Limit values in Table 3. If the result is between these values, the device passes the test.
12. Clear the acquisition using the DAQmx Clear Task VI, as shown in the following table.

LabVIEW Block Diagram	NI-DAQmx Function Call
	<p>Call DAQmxClearTask with the following parameter:</p> <p>taskHandle: taskHandle</p>

13. Repeat steps 3 through 12 for all channels and all Test Point values. NI recommends that you verify all values, although you can save time by verifying only the values used in your application.
14. Disconnect the calibrator from the device.

Analog Input Offset Verification

Complete the following steps to test the performance of the analog input offset of the device:

1. Use copper wires to connect the positive and negative terminals of each channel on the NI 9213 to each other. Wire TC0+ to TC0-, TC1+ to TC1-, and so on. Refer to Figure 1 for the terminal assignments of the NI 9213.
2. If you use C function calls, create a task using DAQmxCreateTask, as shown in the following table. If you use LabVIEW, skip this step. The task is created in step 3 in LabVIEW.

LabVIEW Block Diagram	NI-DAQmx Function Call
<p>LabVIEW does not require this step.</p>	<p>Call DAQmxCreateTask with the following parameters:</p> <p>taskName: <i>AIVerificationTask</i></p> <p>taskHandle: &taskHandle</p>

3. Create and configure an AI voltage channel using the DAQmx Create Virtual Channel VI, as shown in the following table.



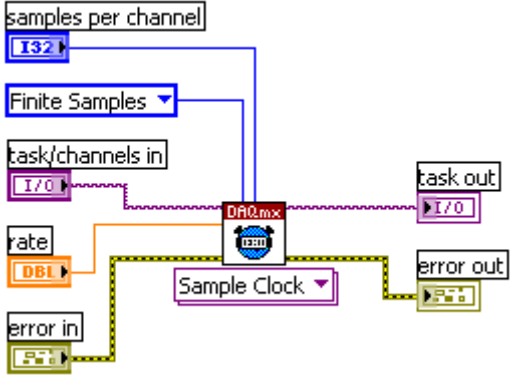
Note Throughout the procedure, refer to the NI-DAQmx function parameters for the LabVIEW input values. Refer to the block diagram images for the correct instance to use for polymorphic VIs.

LabVIEW Block Diagram	NI-DAQmx Function Call
	<p>Call DAQmxCreateAIVoltageChan with the following parameters:</p> <p>taskHandle: taskHandle physicalChannel: dev1/aiX* nameToAssignToChannel: <i>myVoltageChannel</i> terminalConfig: DAQmx_Val_Cfg_Default minVal: -0.078125 maxVal: 0.078125 units: DAQmx_Val_Volts customScaleName: NULL</p>
<p>* X refers to the channel number.</p>	

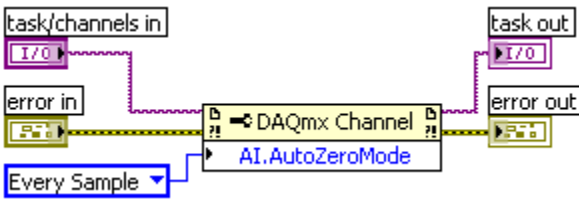
4. Set the timing mode using the DAQmx Channel Property Node, as shown in the following table. Set the timing mode to High Resolution or High Speed, depending on which timing mode you are testing.

LabVIEW Block Diagram	NI-DAQmx Function Call
	<p>Call DAQmxSetChanAttribute with the following parameters:</p> <p>taskHandle: taskHandle Attribute: DAQmx_AI_ADCTimingMode Value: DAQmx_Val_HighResolution or DAQmx_Val_HighSpeed</p>

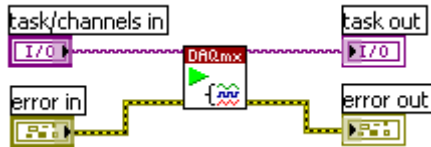
- Configure the timing properties for the voltage acquisition using the DAQmx Timing VI, as shown in the following table.

LabVIEW Block Diagram	NI-DAQmx Function Call
	<p>Call DAQmxCfgSampClkTiming with the following parameters:</p> <p>taskHandle: taskHandle source: NULL rate: 8.9 (High Resolution), 100 (High Speed) activeEdge: DAQmx_Val_Rising sampleMode: DAQmx_Val_FiniteSamps sampsPerChan: 50 (High Resolution), 200 (High Speed)</p>

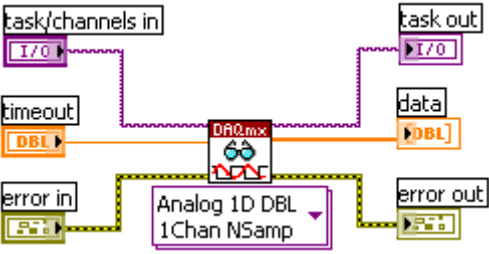
- Enable autozero using the DAQmx Channel Property Node, as shown in the following table.

LabVIEW Block Diagram	NI-DAQmx Function Call
	<p>Call DAQmxSetChanAttribute with the following parameters:</p> <p>taskHandle: taskHandle Attribute: DAQmx_AI_AutoZeroMode Value (Autozero on): DAQmx_Val_EverySample</p>


- Start the acquisition using the DAQmx Start Task VI, as shown in the following table.

LabVIEW Block Diagram	NI-DAQmx Function Call
	<p>Call DAQmxStartTask with the following parameter:</p> <p>taskHandle: taskHandle</p>

8. Acquire the voltage data using the DAQmx Read VI, as shown in the following table.

LabVIEW Block Diagram	NI-DAQmx Function Call
 <p>The diagram shows a DAQmx Read VI block. It has three input terminals: 'task/channels in' (I/O), 'timeout' (DBL), and 'error in' (Error). It has three output terminals: 'task out' (I/O), 'data' (DBL), and 'error out' (Error). A dropdown menu is set to 'Analog 1D DBL' and '1Chan NSamp'.</p>	<p>Call DAQmxReadAnalogF64 with the following parameters:</p> <p>taskHandle: taskHandle numSampsPerChan: -1 timeout: 10.0 fillMode: DAQmx_Val_GroupByChannel readArray: data arraySizeInSamples: 50 (High Resolution), 200 (High Speed) sampsPerChanRead: &read reserved: NULL</p>

9. Average the voltage values that you acquired. Compare the resulting average to the Upper Limit and Lower Limit values in Table 4 for the timing mode you selected previously. If the result is between these values, the device passes the test.
10. Clear the acquisition using the DAQmx Clear Task VI, as shown in the following table.

LabVIEW Block Diagram	NI-DAQmx Function Call
 <p>The diagram shows a DAQmx Clear Task VI block. It has two input terminals: 'task in' (I/O) and 'error in' (Error). It has one output terminal: 'error out' (Error).</p>	<p>Call DAQmxClearTask with the following parameter:</p> <p>taskHandle: taskHandle</p>

11. Repeat steps 2 through 10 for all channels and both timing modes. NI recommends that you verify all values, although you can save time by verifying only the values used in your application.

Specifications

The values in the following table are based on calibrated scaling coefficients, which are stored in the onboard EEPROM. The following calibration specifications are for 23 ± 10 °C.

Table 2. NI 9213 Accuracy

Timing Mode	Percent of Reading (Gain Error)	Percent of Range* (Offset Error)
High Resolution	0.044% max	0.008% (6 μ V) max
High Speed	0.051% max	0.022% (17 μ V) max

* Range equals 78.125 mV.

Test Limits

Tables 3 and 4 list the specifications that the NI 9213 should meet if it has been one year between calibrations. The following definitions describe how to use the information from Tables 3 and 4.

Range

Range refers to the minimum or maximum voltage range of an input signal.

Test Point

The *Test Point* is the voltage value that is input or output for verification purposes. This value is broken down into two columns—*Location* and *Value*. *Location* refers to where the test value fits within the test range. *Value* refers to the voltage value to be verified. *Max* refers to maximum value, *Min* refers to minimum value, and *Mid* refers to mid-scale.

1-Year Limits

The *1-Year Limits* column contains the *Upper Limits* and *Lower Limits* for the test point value. That is, when the device is within its 1-year calibration interval, the test point value should fall between these upper and lower limit values.

Table 3. NI 9213 Gain Verification Test Limits

Timing Mode	Range (V)		Test Point		1-Year Limits	
	Minimum	Maximum	Location	Value (V)	Lower Limit (V)	Upper Limit (V)
High Resolution	-0.078125	0.078125	Max	0.070000	0.069963	0.070037
High Resolution	-0.078125	0.078125	Min	-0.070000	-0.070037	-0.069963
High Speed	-0.078125	0.078125	Max	0.070000	0.069947	0.070053
High Speed	-0.078125	0.078125	Min	-0.070000	-0.070053	-0.069947

Table 4. NI 9213 Offset Verification Test Limits

Timing Mode	Range (V)		Test Point		1-Year Limits	
	Minimum	Maximum	Location	Value (V)	Lower Limit (V)	Upper Limit (V)
High Resolution	-0.078125	0.078125	Mid	0.000000	-0.000006	0.000006
High Speed	-0.078125	0.078125	Mid	0.000000	-0.000017	0.000017

Where to Go for Support

The National Instruments Web site is your complete resource for technical support. At ni.com/support you have access to everything from troubleshooting and application development self-help resources to email and phone assistance from NI Application Engineers.

National Instruments corporate headquarters is located at 11500 North Mopac Expressway, Austin, Texas, 78759-3504.

National Instruments also has offices located around the world to help address your support needs. For telephone support in the United States, create your service request at ni.com/support and follow the calling instructions or dial 512 795 8248. For telephone support outside the United States, contact your local branch office:

Australia 1800 300 800, Austria 43 662 457990-0,
Belgium 32 (0) 2 757 0020, Brazil 55 11 3262 3599,
Canada 800 433 3488, China 86 21 5050 9800,
Czech Republic 420 224 235 774, Denmark 45 45 76 26 00,
Finland 358 (0) 9 725 72511, France 01 57 66 24 24,
Germany 49 89 7413130, India 91 80 41190000, Israel 972 3 6393737,
Italy 39 02 41309277, Japan 0120-527196, Korea 82 02 3451 3400,
Lebanon 961 (0) 1 33 28 28, Malaysia 1800 887710,
Mexico 01 800 010 0793, Netherlands 31 (0) 348 433 466,
New Zealand 0800 553 322, Norway 47 (0) 66 90 76 60,
Poland 48 22 328 90 10, Portugal 351 210 311 210,
Russia 7 495 783 6851, Singapore 1800 226 5886,
Slovenia 386 3 425 42 00, South Africa 27 0 11 805 8197,
Spain 34 91 640 0085, Sweden 46 (0) 8 587 895 00,
Switzerland 41 56 2005151, Taiwan 886 02 2377 2222,
Thailand 662 278 6777, Turkey 90 212 279 3031,
United Kingdom 44 (0) 1635 523545

National Instruments, NI, ni.com, and LabVIEW are trademarks of National Instruments Corporation. Refer to the *Terms of Use* section on ni.com/legal for more information about National Instruments trademarks. Other product and company names mentioned herein are trademarks or trade names of their respective companies. For patents covering National Instruments products/technology, refer to the appropriate location: **Help»Patents** in your software, the `patents.txt` file on your media, or the *National Instruments Patent Notice* at ni.com/patents.